





TREX-8 Step1


一、Welding VTX Module

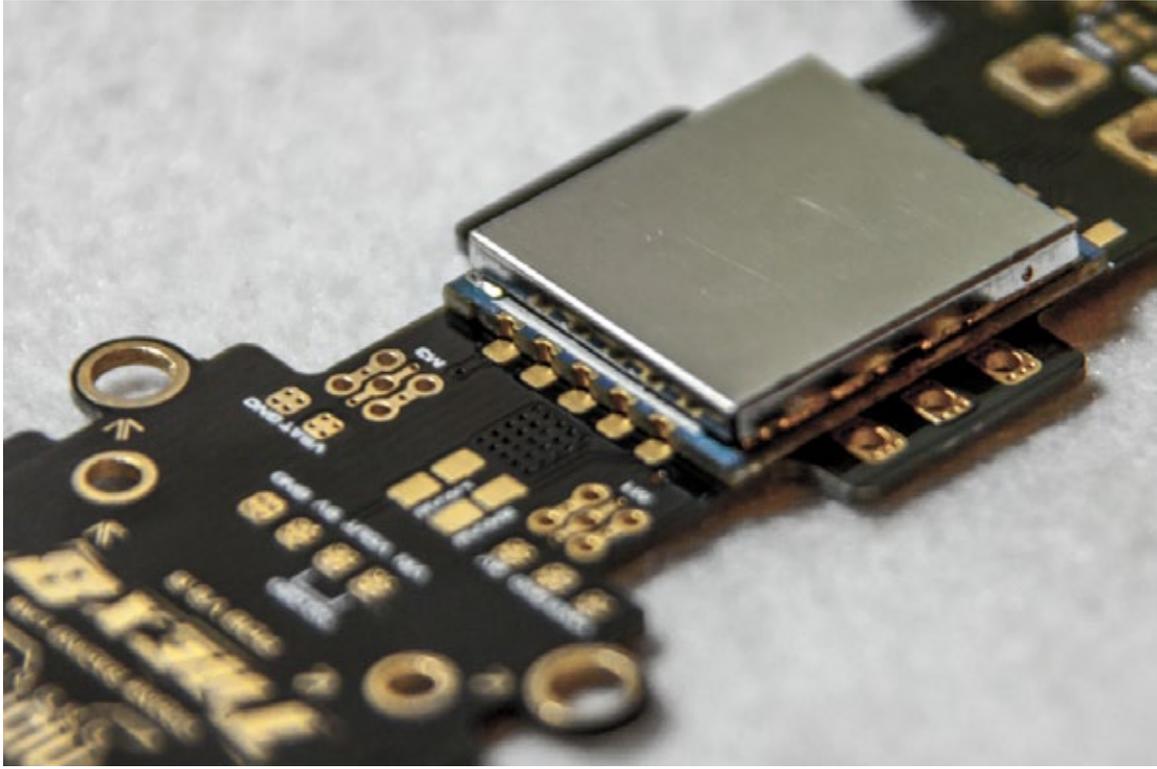


For optimum heat dissipation, light the following diagram steps to install the VTX module

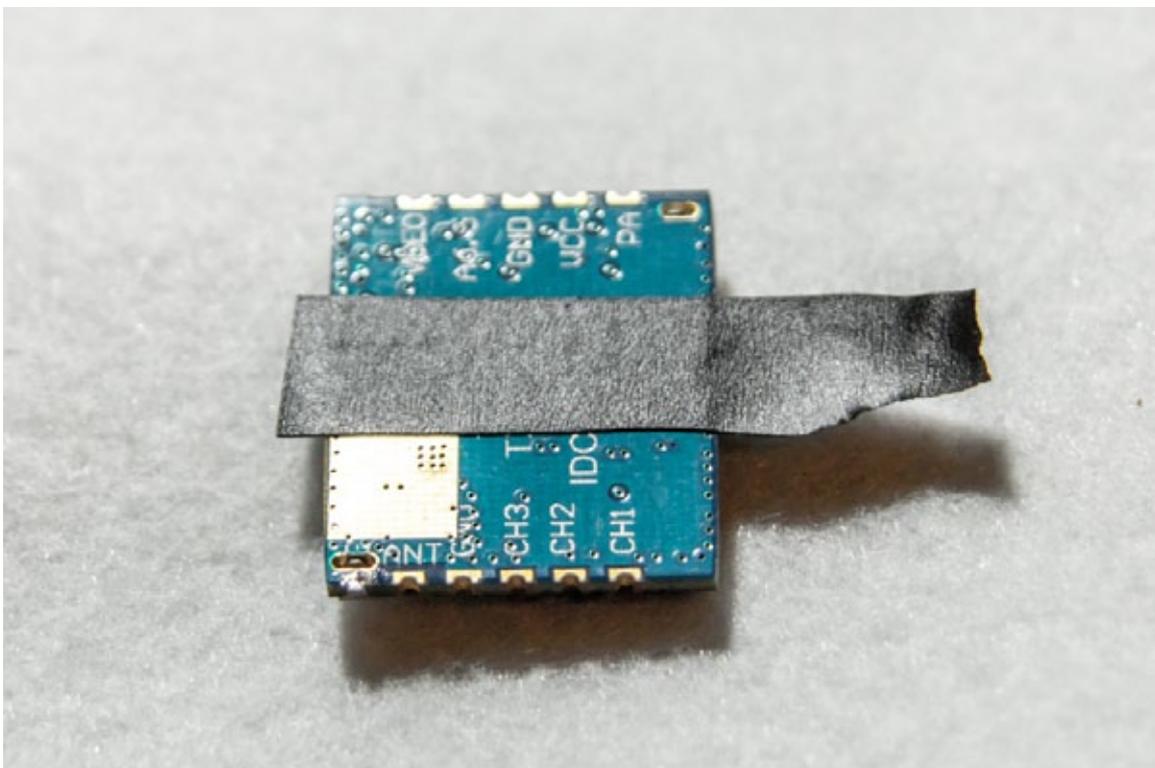


Use a section of insulating tape to hold the middle of the VTX module.

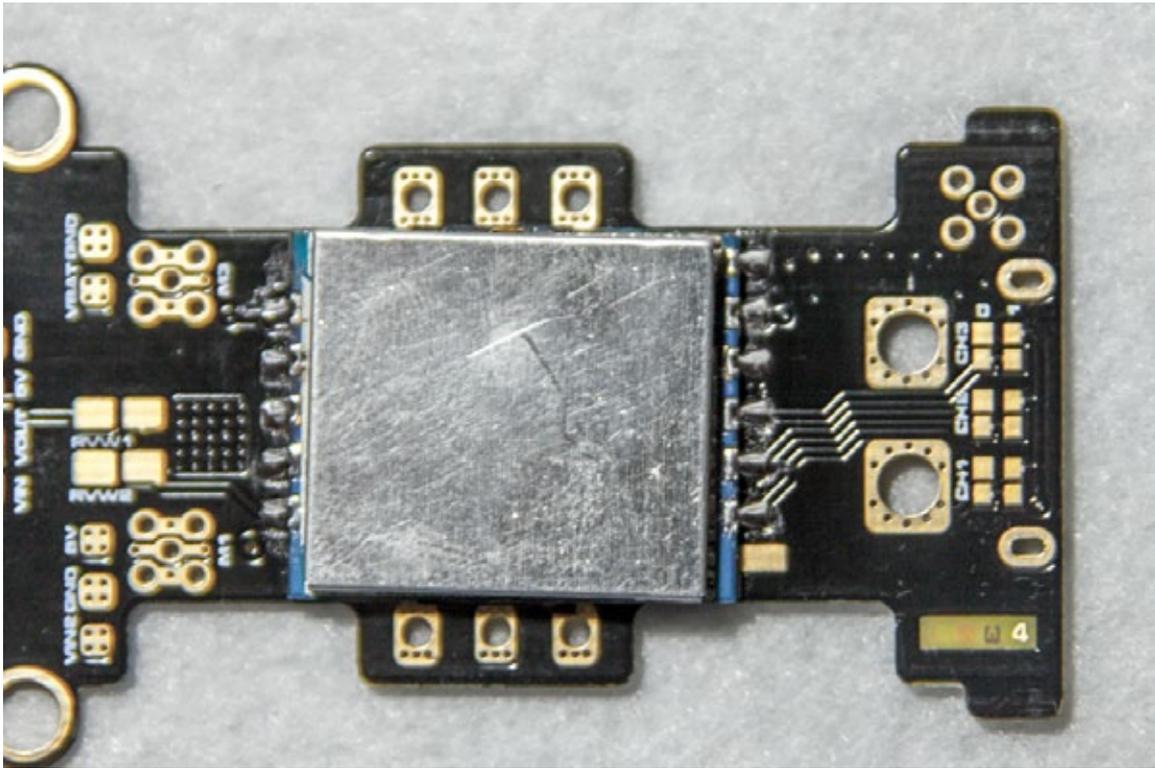


Then the solder plate of the welding module is aligned.

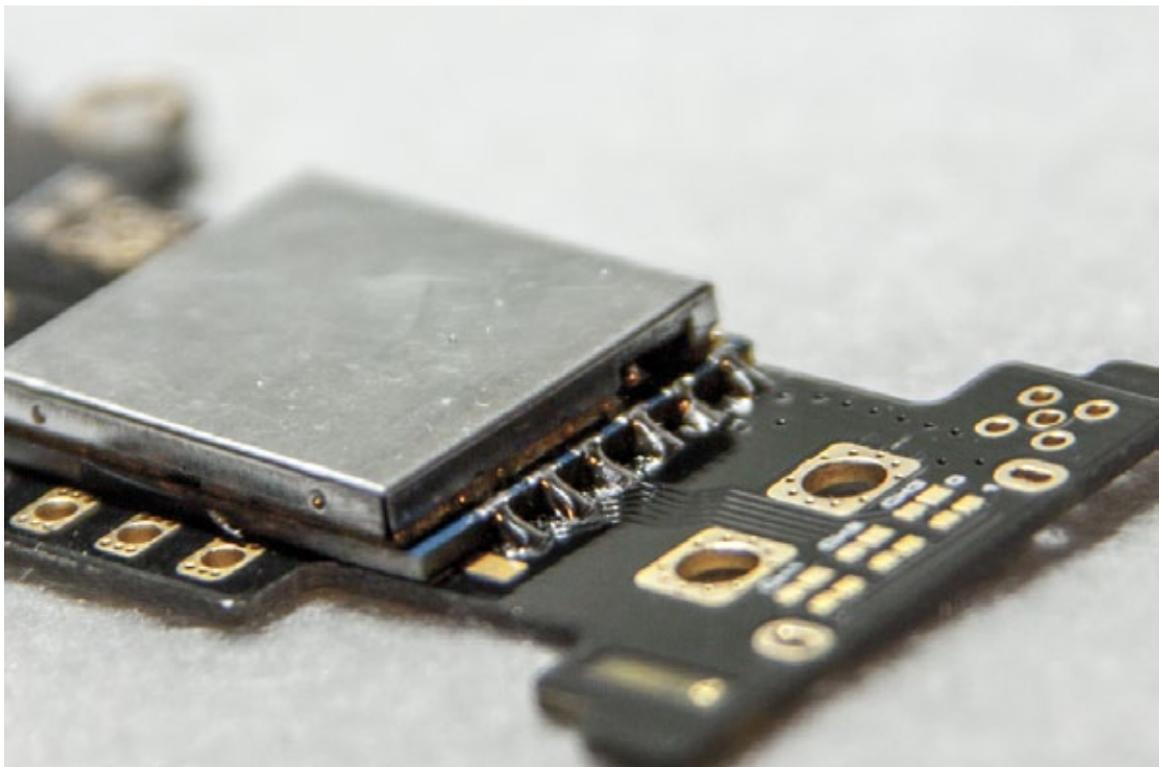


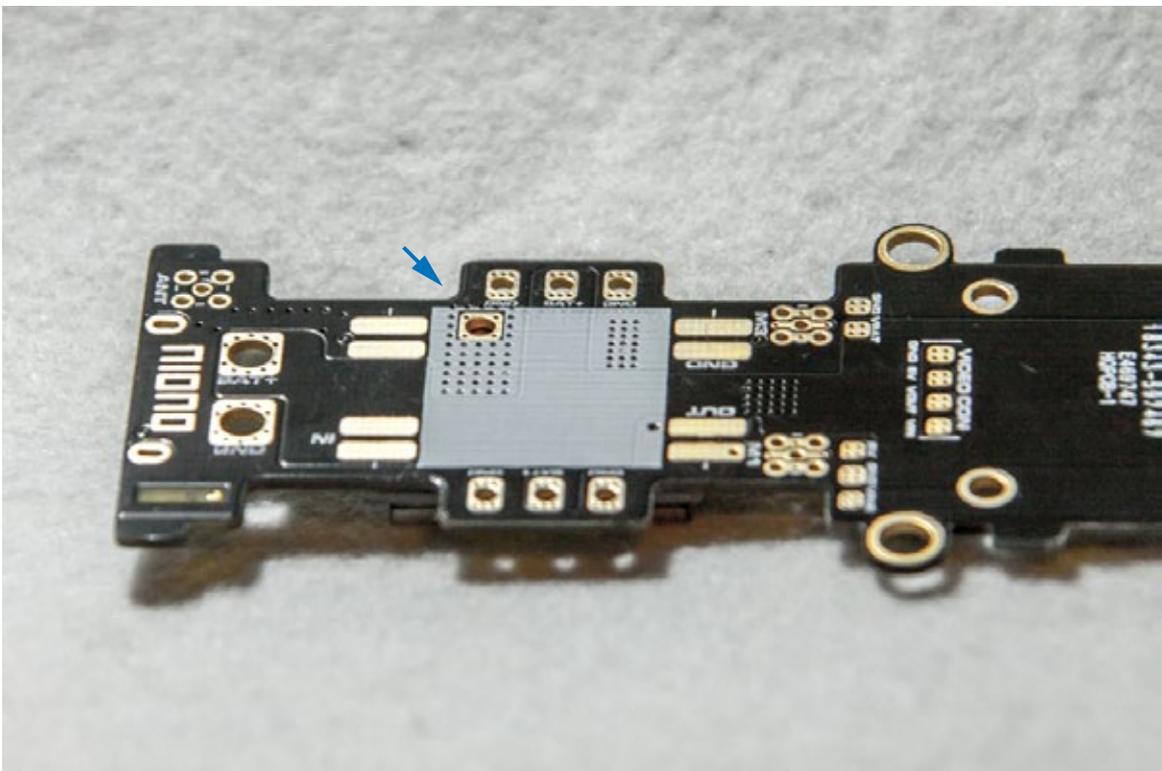

Turn the PDB back into the solder and use rosin or flux for a long time to maintain the temperature to ensure that the hole is filled with solder.


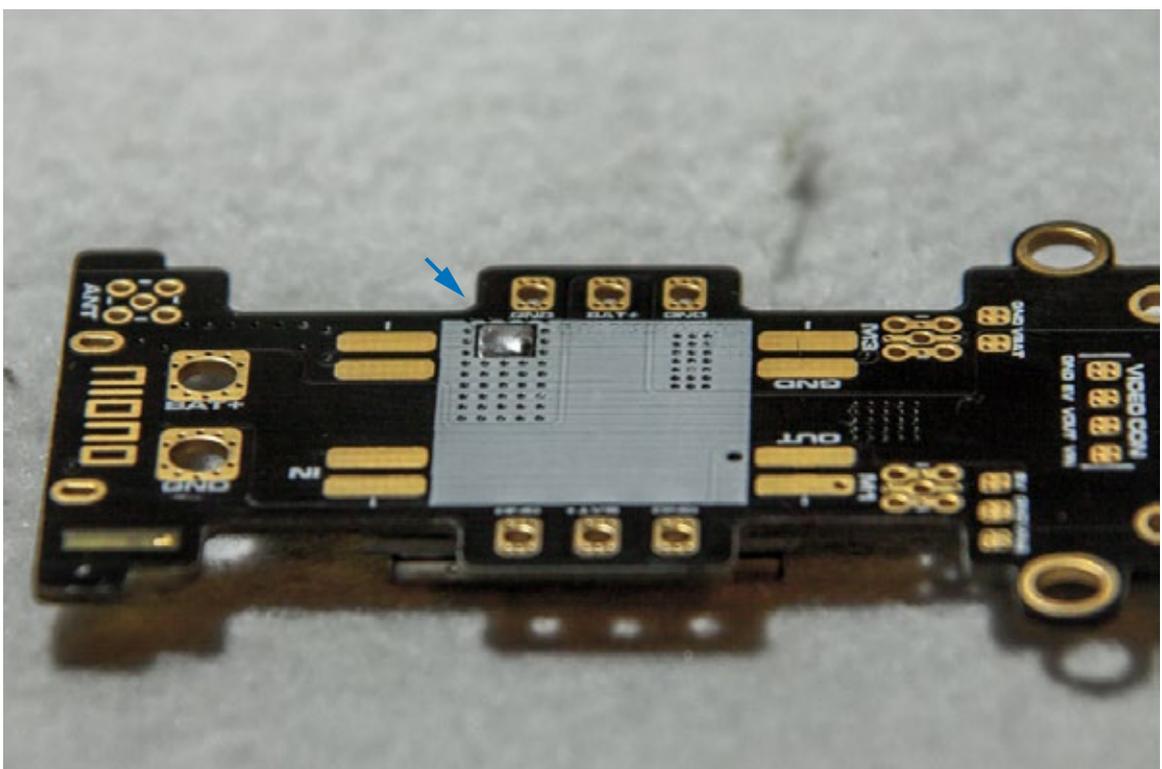


三、MMCX天线座的安装

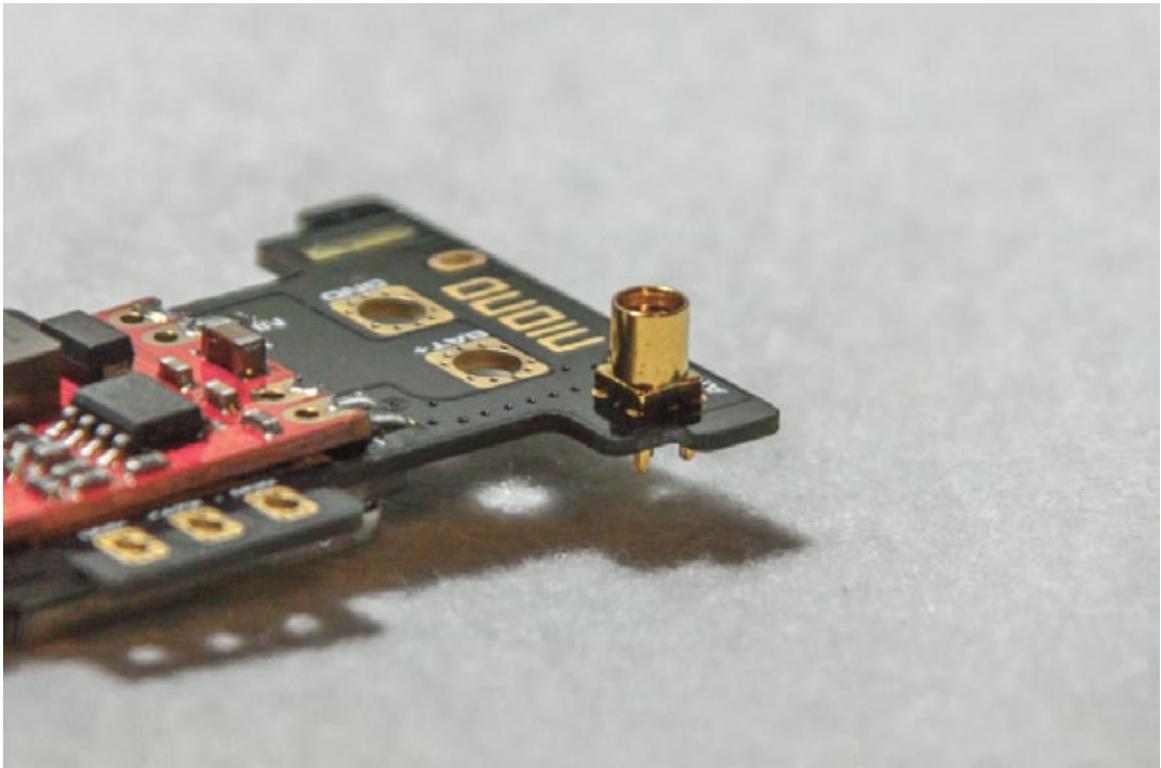


MMCX antenna seat is relatively small, you need a relatively small iron tips to easily complete.


Also refer to our installation steps to ensure that Welding quality.

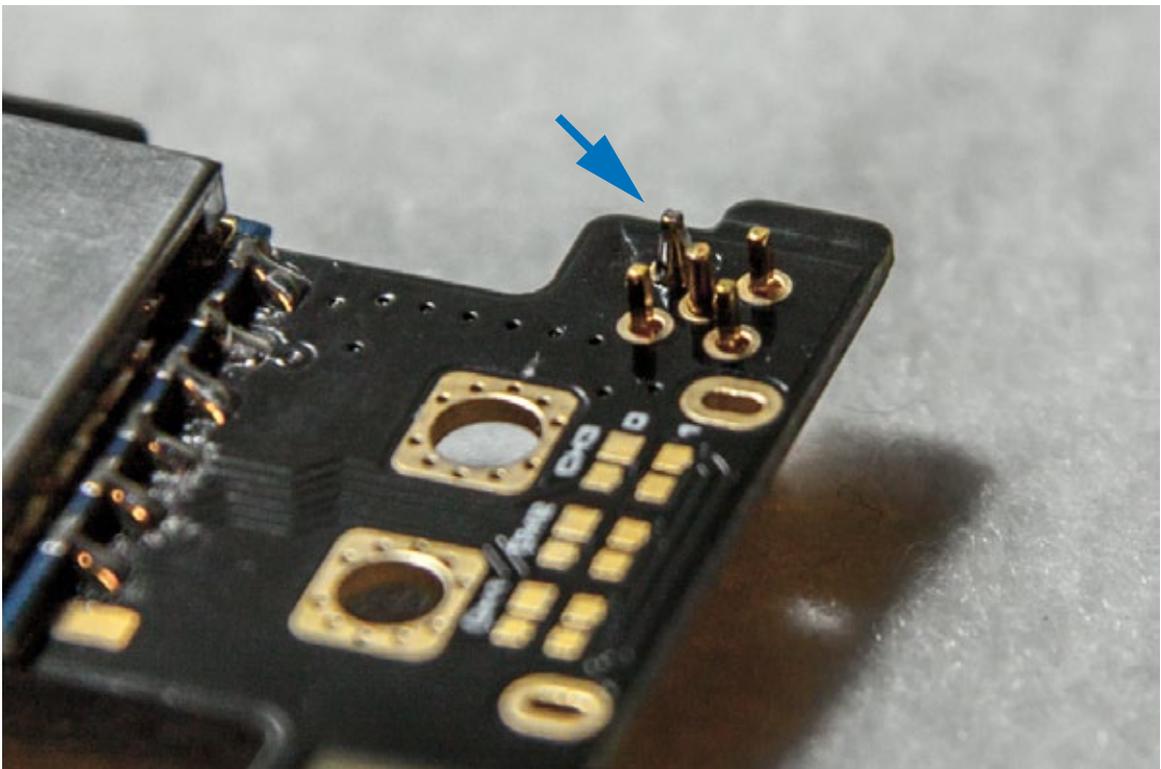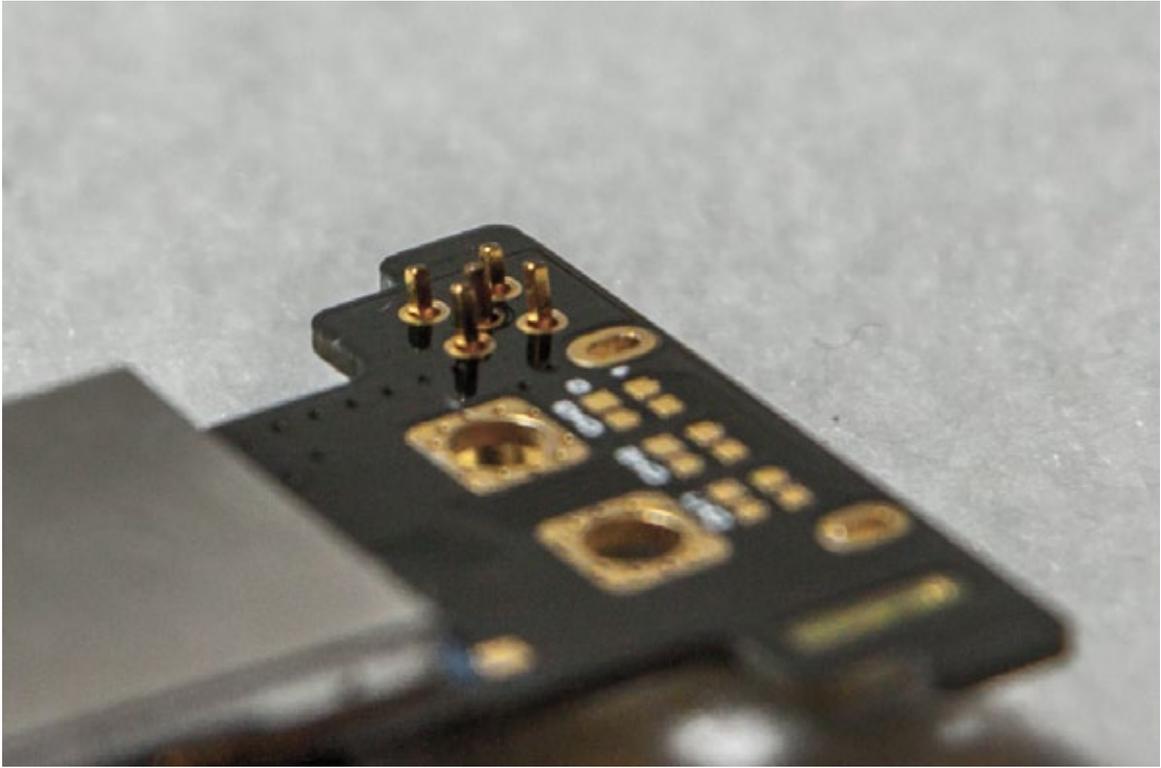


First weld one of the outer legs.

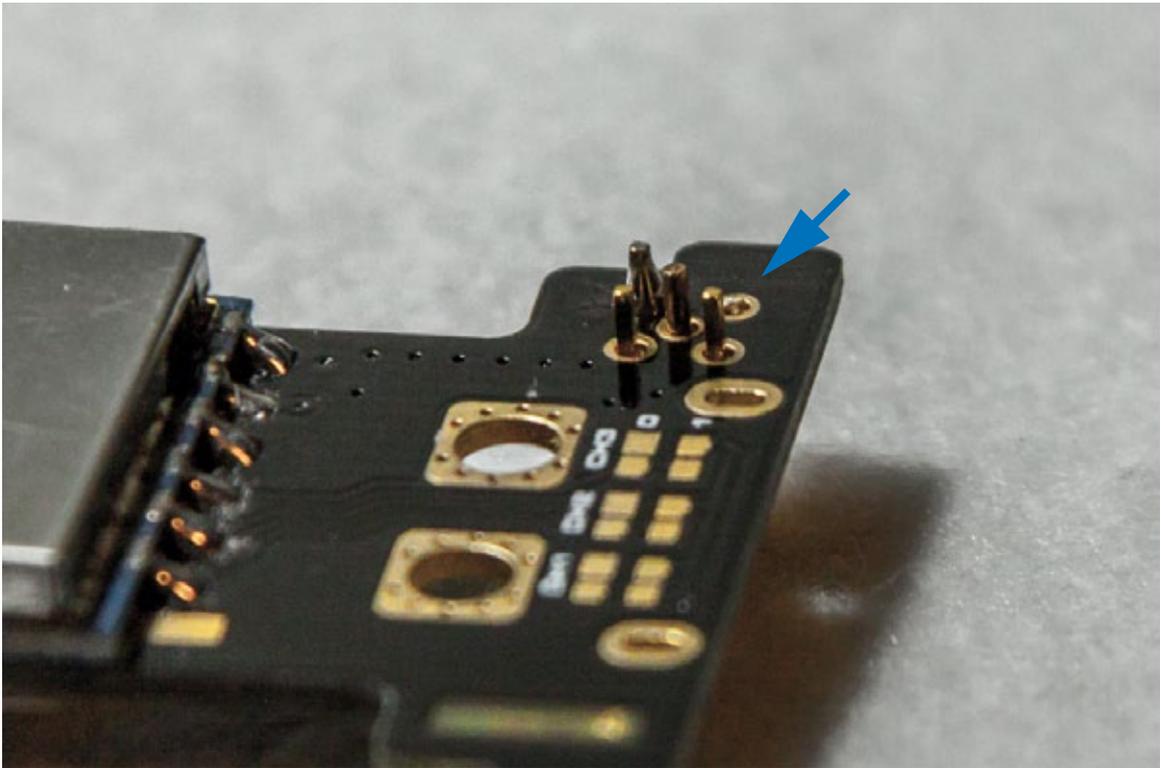

And cut off a leg.

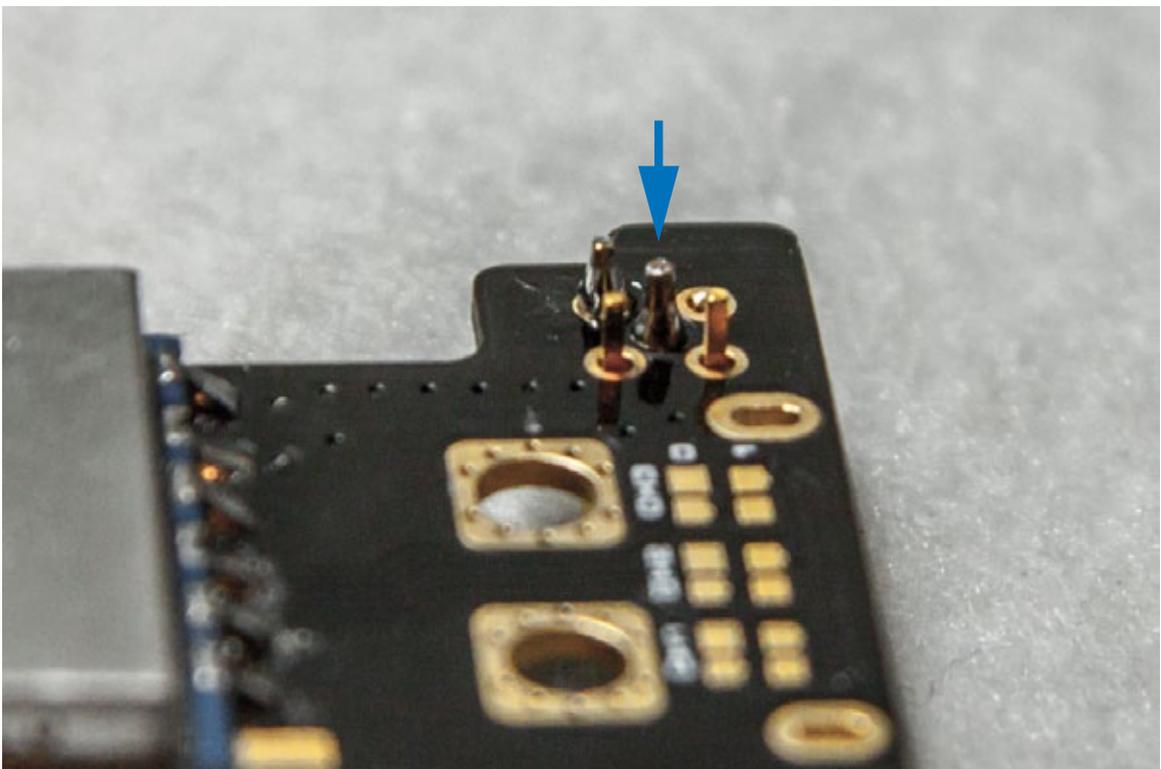



The legs of the welding center

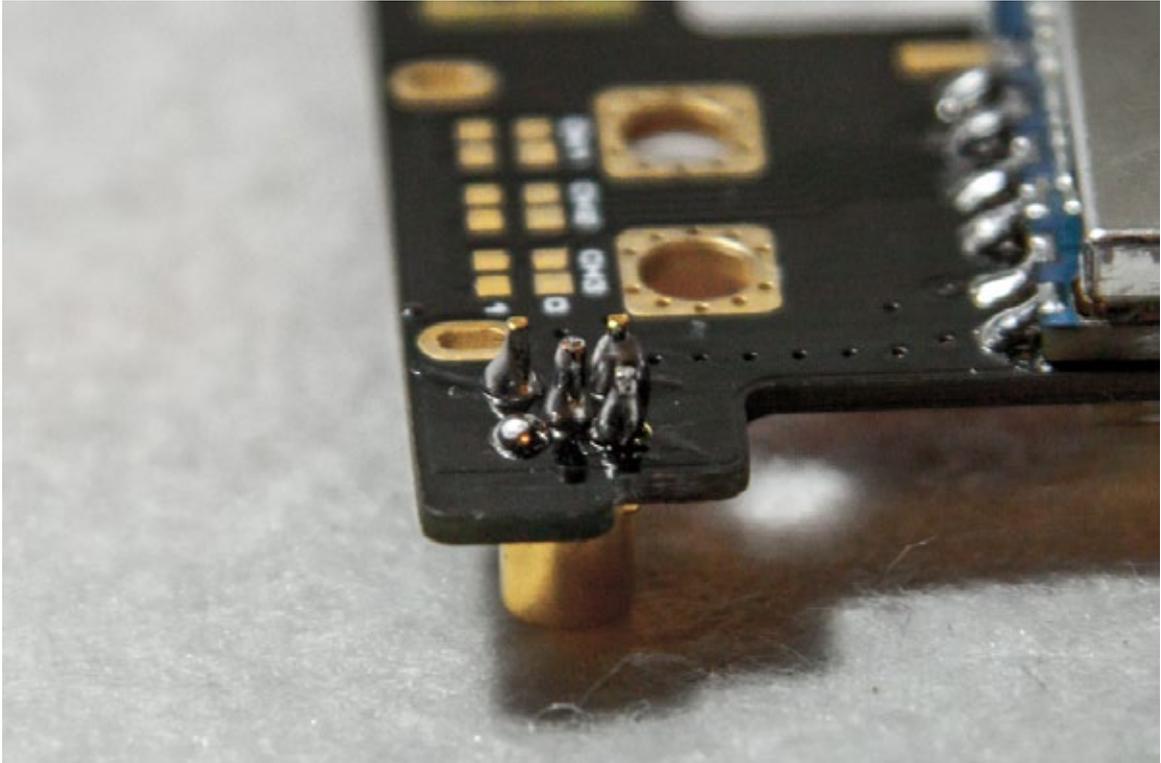


Finally finish the other leg welding, you can also cut them to weld.


四、Welding XT60PW

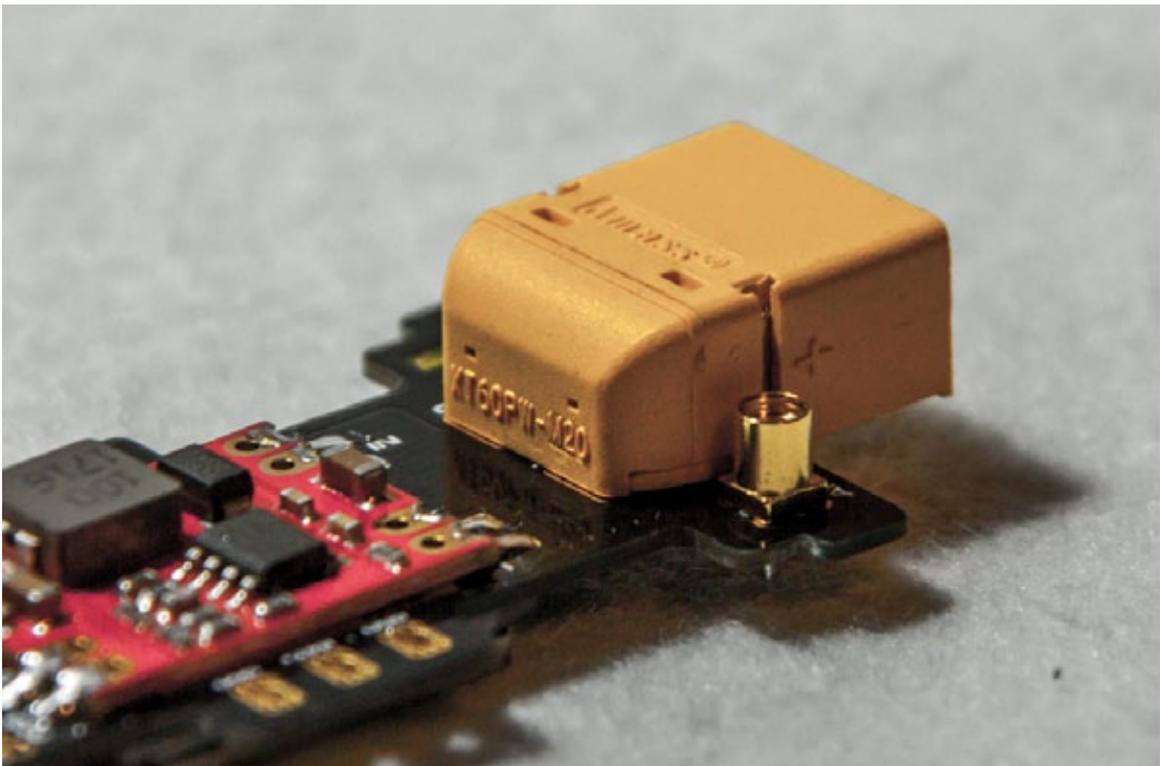

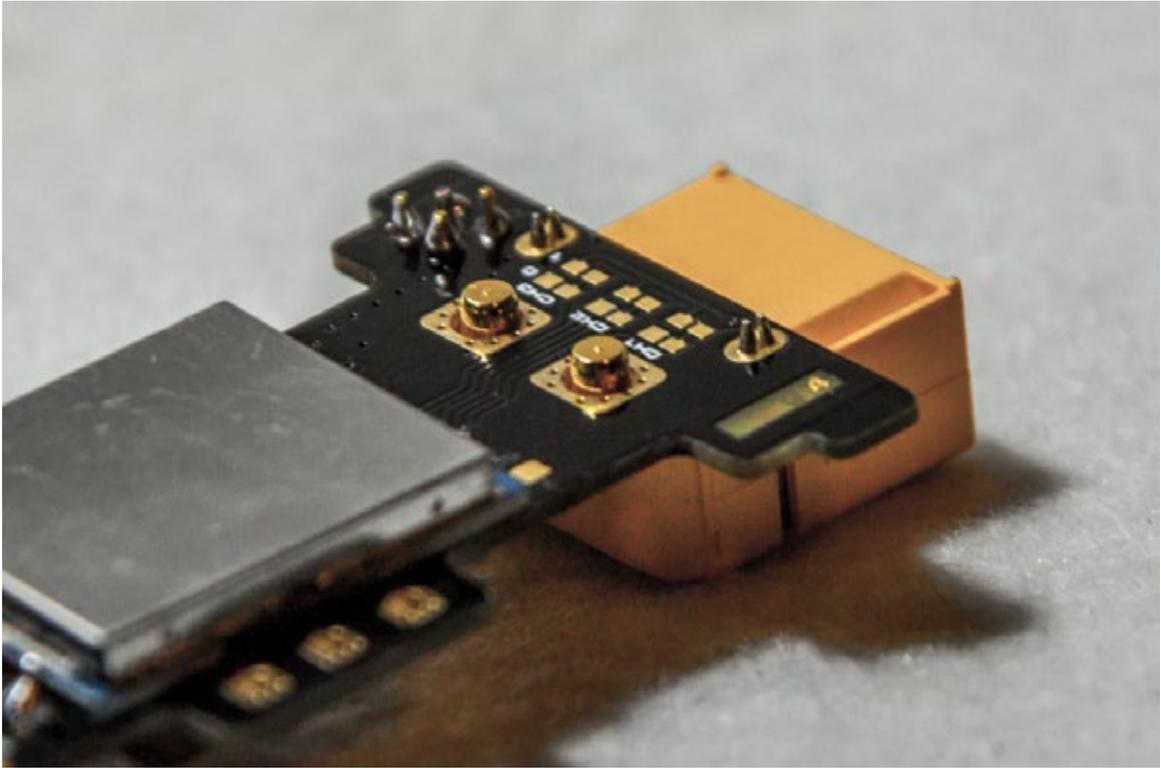



XT60PW welding is easier, only need to maintain a high temperature and time will be able to weld well, but over a long time will melt the plastic shell.

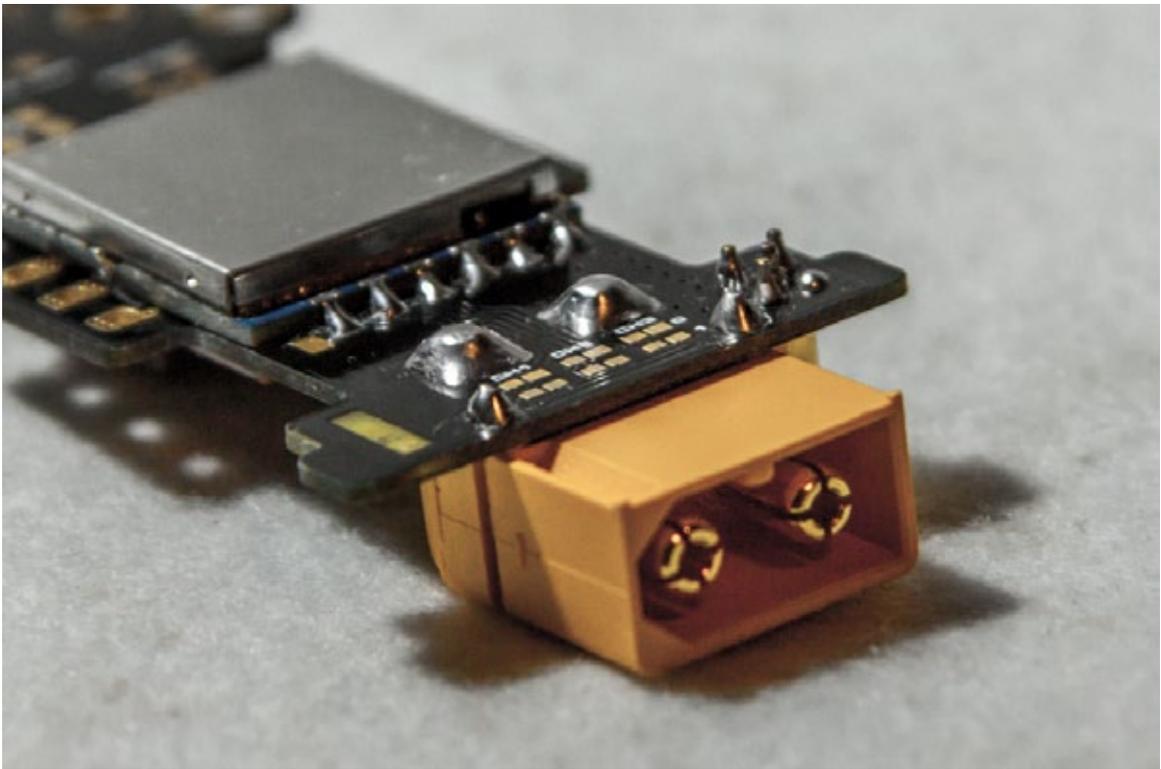

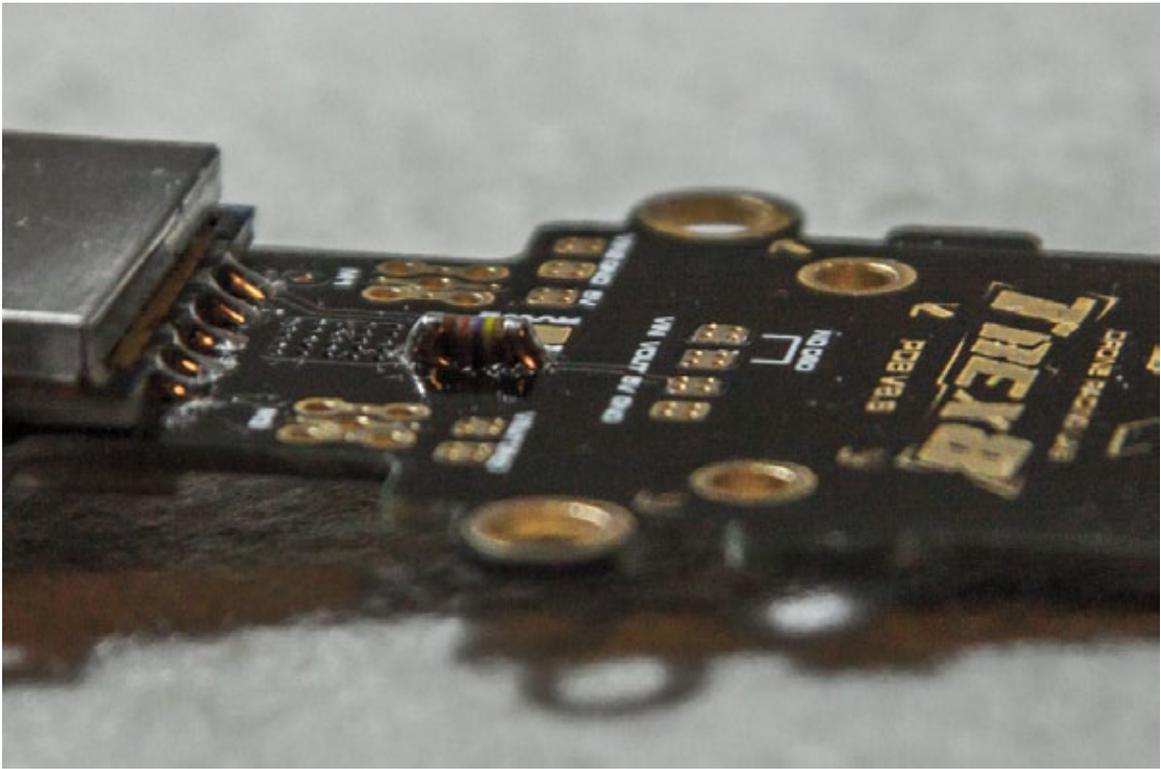

五、Welding SMT Nut

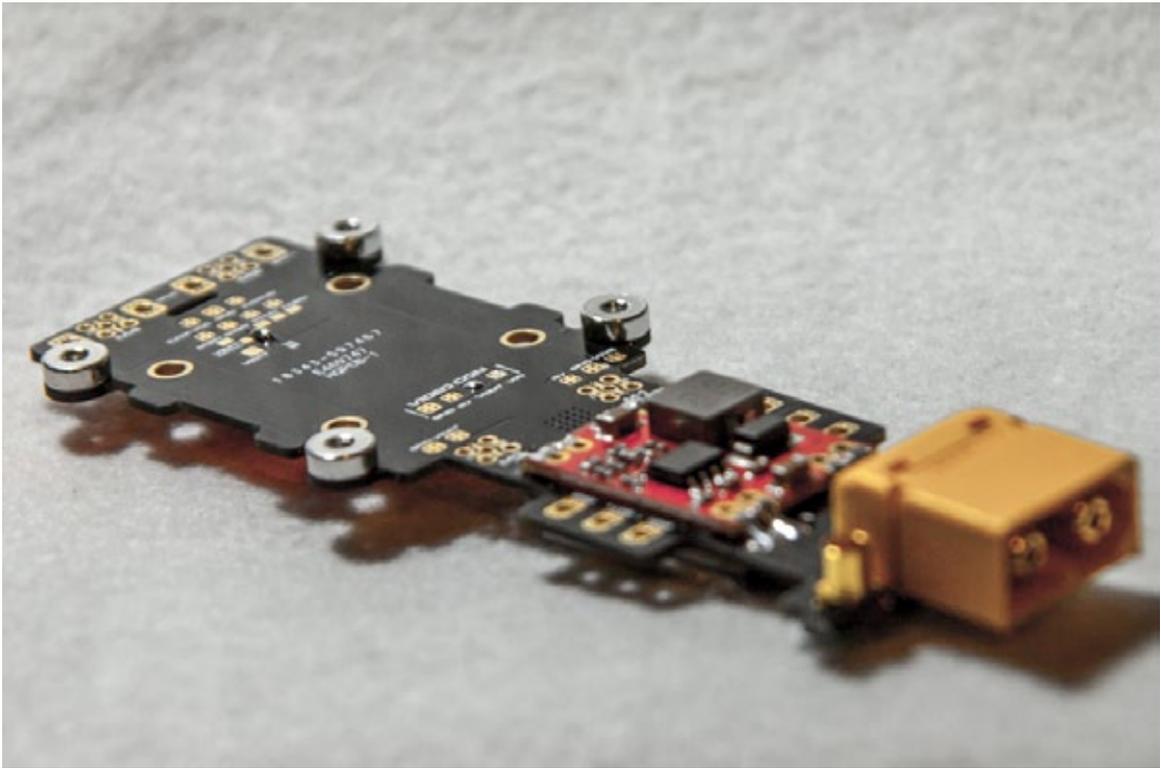

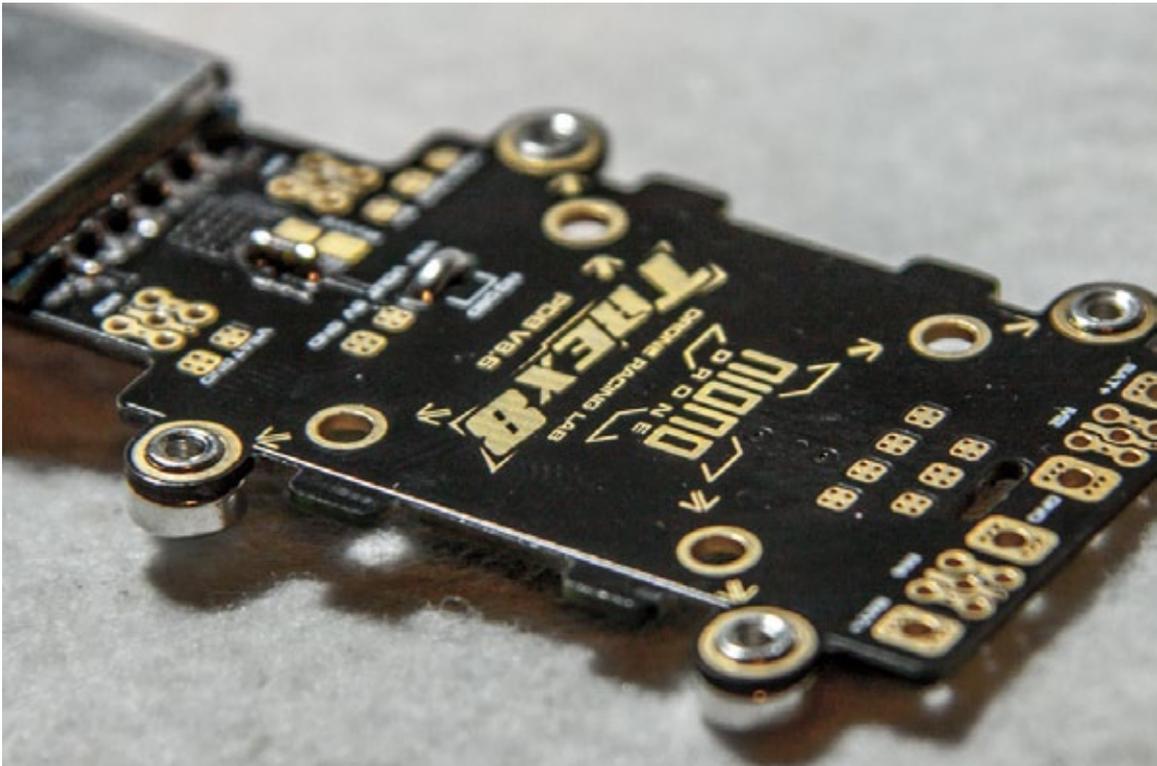

SMT nut for the installation of FC, welding is not difficult, but need attention, try not to use solder plug screw hole, many ways to avoid this, such as plugging in toothpicks, or installation screws, if you have blocked it, it does not matter, forcibly screwed into the screws can be solder removal.

